


Parts needed to mount the KOPRO-30 extrusion

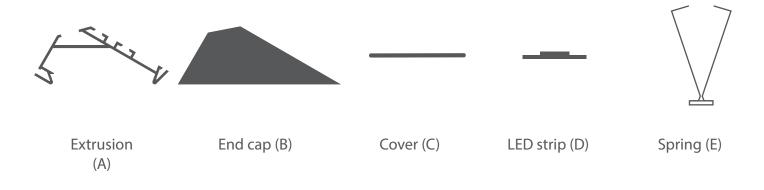


Tools needed for mounting:

- drill
- screwdriver

NOTE! All LED strips must be connected to a 12 V or 24 V power supply.

IMPORTANT: The manual presents the simplest mounting procedure. More mounting procedures and related accessories can be found at klusdesign.eu



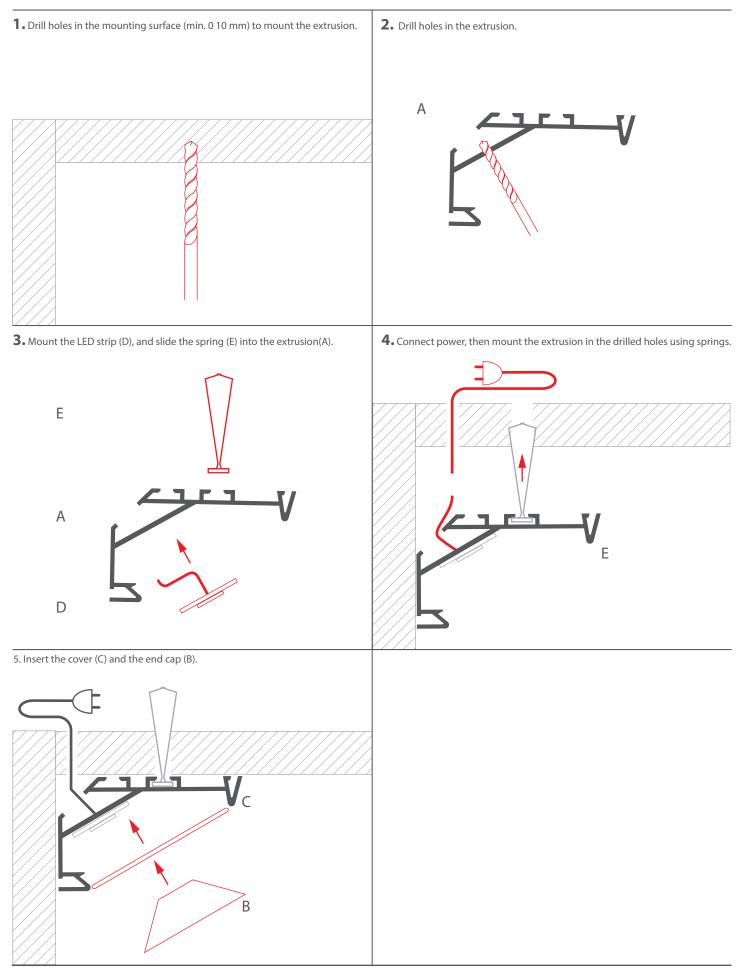

www.klusdesign.eu